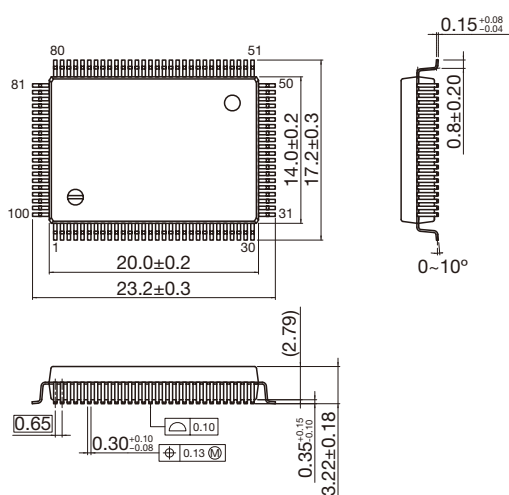
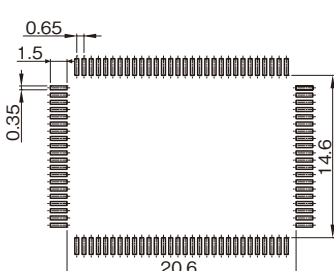
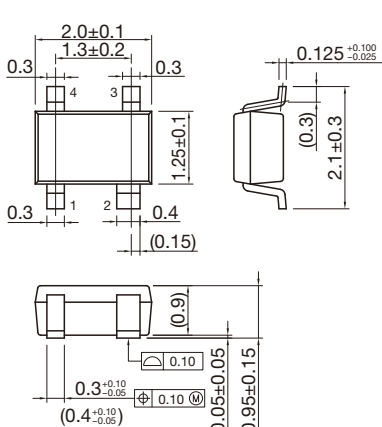
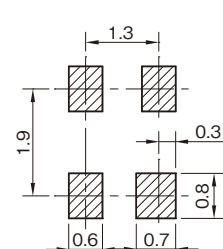


封装

封装名	外形尺寸图	推荐焊盘尺寸图
QFP-100A	 Top view dimensions: 20.0±0.2, 23.2±0.3, 14.0±0.2, 17.2±0.3, 0.15^{+0.08/-0.04}, 0.8±0.20, 0~10°. Side view dimensions: 0.65, 0.30^{+0.10/-0.08}, 0.10, 0.13, 0.35^{+0.15/-0.10}, 3.22±0.18, (2.79).	 Pad dimensions: 0.65, 1.5, 0.35, 20.6, 14.6.
SC-82ABA	 Top view dimensions: 2.0±0.1, 1.3±0.2, 0.3, 0.3, 1.25±0.1, 0.4, (0.15), 0.9, 0.05±0.05, 0.95±0.15, 0.3^{+0.10/-0.05}, (0.4^{+0.10/-0.05}), 0.10, 0.10. Side view dimensions: 0.125^{+0.100/-0.025}, (0.3), 2.1±0.3.	 Pad dimensions: 1.3, 0.3, 0.8, 0.6, 0.7, 1.9.