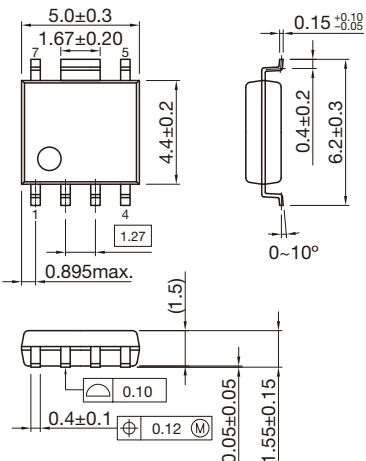
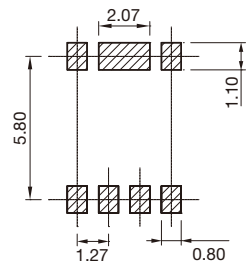
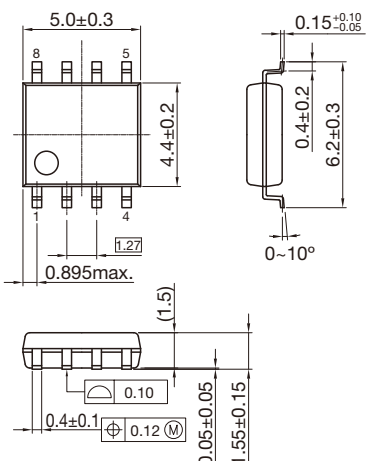
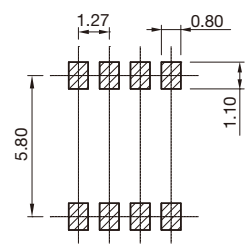


封装

封装名	外形尺寸图	推荐焊盘尺寸图
SOP-7B	 Top view dimensions: 5.0±0.3, 1.67±0.20, 4.4±0.2, 0.895max., 1.27, 0.15^{+0.10/-0.05}, 0.4±0.2, 6.2±0.3, 0~10°. Side view dimensions: 0.15^{+0.10/-0.05}, 0.4±0.2, 6.2±0.3, 0~10°. Bottom view dimensions: 1.5, 0.10, 0.4±0.1, 0.05±0.05, 1.55±0.15, 0.12, 0.05±0.05.	 Recommended pad dimensions: 2.07, 5.80, 1.10, 1.27, 0.80.
SOP-8D	 Top view dimensions: 5.0±0.3, 4.4±0.2, 0.895max., 1.27, 0.15^{+0.10/-0.05}, 0.4±0.2, 6.2±0.3, 0~10°. Side view dimensions: 0.15^{+0.10/-0.05}, 0.4±0.2, 6.2±0.3, 0~10°. Bottom view dimensions: 1.5, 0.10, 0.4±0.1, 0.05±0.05, 1.55±0.15, 0.12, 0.05±0.05.	 Recommended pad dimensions: 1.27, 0.80, 5.80, 1.10.